



Bryan Cournoyer <nextest401@gmail.com>

0111910 Somersworth One Stop II - Hydrostatic Sump Testing

1 message

Bryan Cournoyer <nextest401@gmail.com>

Tue, Nov 21, 2023 at 9:23 PM

To: Mike Lowry <mlowry@mabardyoil.com>, Charlie Mabardy <charlie@mabardyoil.com>

T-5A Regular STP Sump - PASS

T-5B Super STP Sump- FAIL - Entry boot on product line is torn and split wide open. See attached picture.

Dispenser 1-2 Sump - VISUAL FAIL - Secondary layer of piping on the super line is split wide open and a potential for catastrophic failure of primary line, that section of piping needs to be replaced before being put back into operation.. Secondary boots are also hardened and some fused onto piping and could not be moved into proper position to be able to seal up secondary piping to be able to do hydrostatic test., See attached pic.

Dispenser 3-4 Sump - VISUAL FAIL - .Secondary boots are hardened and fused onto piping and could not be moved into proper position to be able to seal up secondary piping to be able to do hydrostatic testing. See attached pic.

I have attached pics of all your sumps that failed at your facility.

If you have any questions, please feel free to contact me.

Thanks,
Bryan

--

PLEASE NOTE OUR NEW MAILING ADDRESS

NEXTEST
2220 Plainfield Pike, Suite 202
Cranston, RI 02921

Toll Free: 800-858-9128
Office: 401-723-0247
Cell: 401-651-2606

nextest401@gmail.com

5 attachments



Super STP Sump (1).JPG
95K



Dispenser 1-2 Sump (1).JPG
73K



Dispenser 3-4 Sump.JPG
116K



Dispenser 1-2 Sump (2).JPG
122K



Super STP Sump (2).JPG
129K