

**CERTIFICATE OF STORAGE TANK SYSTEM TESTING**

Crompco, LLC
1815 Gallagher Road
Plymouth Meeting, PA 19462

Phone: (610) 278-7203
Fax: (610) 278-7621

Work Order #543863	Client Information	Location #NH0018	
Date: Mon Sep 30th, 2019 Reason: Compliance	Cross America Partners, LP (Tammy Hessler) Invoice # 753058 Permit# P.O.# Green050045	Cross America Partners, LP BP Service Station 4 Amherst Street Milford, NH 03055 County: Hillsborough State ID: 0113095	
Testing was conducted in accordance with all applicable portions of Federal, NFPA, and local regulations.			
Vapor Recovery - Stage I / Stage II			
Test		Result	
Pressure Decay		Pass	
Pressure Decay		Pass	
Cathodic Protection: Tanks			
Equip #	Grade	Test	Result
8	Diesel	CP: Tanks	Pass
Miscellaneous Inspections			
Test		Result	
CP: Continuity (Fixed Reference Cell)		Completed	
Secondary Containment			
Equip #	Grade	Test	Result
1	Regular	Spill Bucket: Dry Break	Pass
1	Regular	Spill Bucket	Pass
2	Diesel	Spill Bucket	Pass
Additional Costs			
MISCELLANEOUS FIELD SERVICES: Additional Pressure Decay Test			

Felix Nguessan
NACE Cathodic Protection Technician# 17393

Cheyne Graves
OPW Stage I EVR Executive Order VR-102 Attestation# 0179481

Crompco, LLC
1815 Gallagher Road
Plymouth Meeting, PA 19462

BP Service Station
Phone: (610) 278-7203
FAX: 610-278-7621

4 Amherst Street
Milford, NH 03055
State ID: 0113095

Facility/Agency Copy
Site #NH0018 / WO #543863
Mon Sep 30th, 2019

Pressure Decay Test

Result: ☒ Pass ☐ Fail ☐ Inconclusive

System Info

Vapor Recovery Type: <input type="checkbox"/> Balance <input type="checkbox"/> Vac Assist <input checked="" type="checkbox"/> Inactive	Manufacturer: N/A - Inactive Number of Nozzles: 0 Stage 1 Type: Dual Point	Manifolded: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
---	--	---

					Pressure (in H2O)					
Grade	Capacity (gal)	Volume Present (gal)	Ullage (gal)	Init. Pressure (in H2O)	1.0 min	2.0 min	3.0 min	4.0 min	5.0 min	Allowable
Regular	9683	0	9683							
	9683	0	9683	10.000	10.00	10.00	10.00	10.00	10.00	9.587

Crompco, LLC
1815 Gallagher Road
Plymouth Meeting, PA 19462

BP Service Station
Phone: (610) 278-7203
FAX: 610-278-7621

4 Amherst Street
Milford, NH 03055
State ID: 0113095

Facility/Agency Copy
Site #NH0018 / WO #543863
Mon Sep 30th, 2019

Pressure Decay Test

Result: ☒ Pass ☐ Fail ☐ Inconclusive

System Info

Vapor Recovery Type: <input type="checkbox"/> Balance <input type="checkbox"/> Vac Assist <input checked="" type="checkbox"/> Inactive	Manufacturer: N/A - Inactive Number of Nozzles: 0 Stage 1 Type: Dual Point	Manifolded: <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No
---	--	---

					Pressure (in H2O)					
Grade	Capacity (gal)	Volume Present (gal)	Ullage (gal)	Init. Pressure (in H2O)	1.0 min	2.0 min	3.0 min	4.0 min	5.0 min	Allowable
Diesel	6012	0	6012							
	6012	0	6012	10.000	10.00	10.00	10.00	10.00	10.00	9.381

Crompco, LLC
1815 Gallagher Road
Plymouth Meeting, PA 19462

BP Service Station
Phone: (610) 278-7203
FAX: 610-278-7621

4 Amherst Street
Milford, NH 03055
State ID: 0113095

Facility/Agency Copy
Site #NH0018 / WO #543863
Mon Sep 30th, 2019

Cathodic Protection: Tanks	
Tank #	8
Grade:	Diesel
Material:	Steel
Capacity:	6012
Cathode Type:	Sacrificial
Installation:	Unknown
Location 1	
Half Cell Location:	Interstitial Riser
Half Cell Location Description (optional):	NORTH END
Energized On (local):	-1210 mv
Instant Off (local):	mv
Native (local):	mv
Native (remote):	mv
Location 2	
Half Cell Location:	Monitor riser
Half Cell Location Description (optional):	ATG RISER
Energized On:	-1108 mv
Instant Off:	mv
Native (local):	mv
Native (remote):	mv
Location 3	
Half Cell Location:	Fill riser
Half Cell Location Description (optional):	SOUTH END
Energized On:	-1025 mv
Instant Off:	mv
Native (local):	mv
Native (remote):	mv
Comments / Failure Notes:	
Result:	P

Crompco, LLC
1815 Gallagher Road
Plymouth Meeting, PA 19462

BP Service Station
Phone: (610) 278-7203
FAX: 610-278-7621

4 Amherst Street
Milford, NH 03055
State ID: 0113095

Facility/Agency Copy
Site #NH0018 / WO #543863
Mon Sep 30th, 2019

CP Test: Continuity

CP System On/Off: <input type="checkbox"/> Unknown <input checked="" type="checkbox"/> On <input type="checkbox"/> Off	Junction Box with Annode Shunts (ICCP Only) <input type="checkbox"/> Unknown <input type="checkbox"/> Yes <input type="checkbox"/> No	
Fixed Reference Cell Location: Grass / Soil - North BEHIND BUILDING	Is there a Lead Wire Present? <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	Is the lead wire continuous with the tank bottom? <input type="checkbox"/> Yes <input type="checkbox"/> No
Structure Tested	Structure-to-Soil Potential Using Fixed Reference Cell	Instant Off
Extractor Riser north riser	-783 mv	mv
ATG Riser	-813 mv	mv
Diesel Tank Bottom AT ATG RISER	-1208 mv	mv
Gas Line IN SIPHON SUMP	-1270 mv	mv
Extractor Riser SOUTH RISER	-761 mv	mv
Fill Riser	-742 mv	mv
Diesel Tank Bottom AT FILL RISER	-970 mv	mv

Crompco, LLC
1815 Gallagher Road
Plymouth Meeting, PA 19462

BP Service Station
Phone: (610) 278-7203
FAX: 610-278-7621

4 Amherst Street
Milford, NH 03055
State ID: 0113095

Facility/Agency Copy
Site #NH0018 / WO #543863
Mon Sep 30th, 2019

Secondary Containment Test

Containment Type: Spill Bucket: Dry Break		Dry Break Location: Reg		Manufacturer: EBW 5 gallon	Equip # / Location: 1	Height from bottom of sump to top of highest penetration (in inches) 0
Method: <input type="checkbox"/> Hydro <input checked="" type="checkbox"/> Vacuum	Grade: Regular	Result: P	Start Time: 08:50 End Time: 08:51	Start Date: 2019-09-30 End Date: 2019-09-30	Start Vacuum (inches H2O) 30 End Vacuum (inches H2O) 30	

Secondary Containment Test

Containment Type: Spill Bucket		Dry Break Location:		Manufacturer: EBW 5 gallon	Equip # / Location: 1	Height from bottom of sump to top of highest penetration (in inches) 0
Method: <input checked="" type="checkbox"/> Hydro <input type="checkbox"/> Vacuum	Grade: Regular	Result: P	Start Time: 12:35 End Time: 13:35	Start Date: 2019-09-30 End Date: 2019-09-30	Start Level (inches): 12 End Level (inches): 12	

Secondary Containment Test


Containment Type: Spill Bucket		Dry Break Location:		Manufacturer: EBW 5 gallon	Equip # / Location: 2	Height from bottom of sump to top of highest penetration (in inches) 0
Method: <input checked="" type="checkbox"/> Hydro <input type="checkbox"/> Vacuum	Grade: Diesel	Result: P	Start Time: 12:36 End Time: 13:36	Start Date: 2019-09-30 End Date: 2019-09-30	Start Level (inches): 12 End Level (inches): 12	

Crompco, LLC
1815 Gallagher Road
Plymouth Meeting, PA 19462

BP Service Station
Phone: (610) 278-7203
FAX: 610-278-7621

4 Amherst Street
 Milford, NH 03055
State ID: 0113095

Facility/Agency Copy
 Site #NH0018 / WO #543863
 Mon Sep 30th, 2019







Date: 2019-09-30

Work Order #: 543863

Location #: NH0018

Remote Fill	ATG	Road	Fixed Reference Cell	Circuit Breaker	Vent	Overfill Alarm
Dry Brake	Emergency Stop	Block	Stage 1 w/ Extractor	Interstitial	Containment Sump	Dispenser
	Riser	Fill	CP Test Station	Temp Well Installed	Monitor	Rectifier
	Anode	STP	Flapper Direction	Compass	Well	Drop Tank
	Extractor	CP Junction Box	Tank	Manway	DW Fill	Remote Dry Brake

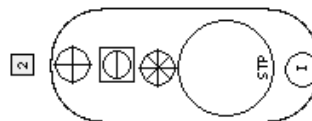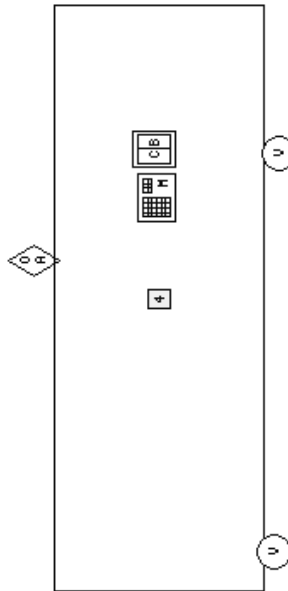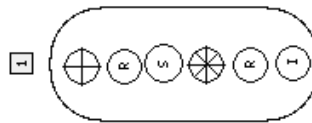

Crompco, LLC
1815 Gallagher Road
Plymouth Meeting, PA 19462

BP Service Station
Phone: (610) 278-7203
FAX: 610-278-7621

4 Amherst Street
Milford, NH 03055
State ID: 0113095

Facility/Agency Copy
Site #NH0018 / WO #543863
Mon Sep 30th, 2019

Site Diagram Labels

- 1: Tank - T-3 Diesel 6K
- 2: Tank - T-1 Regular 10K
- 3: Road - Amherst St.
- 4: Block - Garage
- 5: Dispenser - 1/2
- 6: Dispenser - 3/4 Diesel
- 7: Dispenser - Out of Service premium dispneser. tank removed



TEST RESULTS

October 07th, 2019

Department of Environmental Services
UST Program
6 Hazen Drive
P.O. Box 95
Concord, NH 03302-0095

Test Results - UST Testing

Dear Sir / Madam:

Enclosed are copies of the test results performed by Crompco at the location listed below. On behalf of our customer, these results are being submitted to you in accordance with local regulations. Copies of the test results were also sent to the facility to be retained at the location in case an inspection would occur by a state or local agency.

ID Numbers	Address	Test Date	Crompco Work Order	Test(s) Performed
Location: NH0018 UST: 0113095	4 Amherst Street Milford, NH 03055	Mon Sep 30th, 2019	543863	Secondary Containment (Sump, Containment, Bucket) CP: Tanks

If you should have any questions regarding the tests enclosed, please contact Crompco at 1-800-646-3161.

Sincerely,

Francyne Klein
Compliance Administrator



TEST RESULTS

October 07th, 2019

New Hampshire Department of
Environmental Services
Attn: Harding Schofield
Air Resources Division - Vapor Recovery
6 Hazen Drive
P O Box 95
Concord, NH 03302-0095

Test Results - Vapor Recovery

Dear Sir / Madam:

Enclosed are copies of the test results performed by Crompco at the location listed below. On behalf of our customer, these results are being submitted to you in accordance with the DNRES/UST Control of Volatile Organic Compound Emissions Regulations. Copies of the test results were also sent to the facility to be retained at the location in case an inspection would occur by a state or local agency.

Facility #	Address	Test Date	Crompco Work Order	Test(s) Performed
NH0018	4 Amherst Street Milford, NH 03055	Mon Sep 30th, 2019	543863	Pressure Decay

If you should have any questions regarding the tests enclosed, please contact Crompco at 1-800-646-3161

Sincerely,

Francyne Klein
Compliance Administrator

Work Ticket #: 543863
PO #: Green050045
Address: 4 Amherst Street Milford, NH 03055
Station #: NH0018
Service Date: 09/30/2019

Parts Sold

Quantity Sold	Part Name	Manufacturer	Part #	Description
---------------	-----------	--------------	--------	-------------

Service Details

Crompco was on site performing testing, repairs, calibration and/or inspections for the following reason:

Compliance

Comments

Gallons Pumped:

Site Arrival Time: Site Depart Time:

Confirmation

By signing this verification you are agreeing that Crompco LLC performed various compliance testing and/or repairs and replaced parts as listed above.

Printed Name

Email

Signature

- ☐ Signature captured
☐ Refused to sign
☒ No one available to sign